



[En Español](#)

⁴⁵³ Sure Signal Products Recalls Heat-Activated Fire Alarms Due to Failure to Alert Consumers of a Fire

A defective fuse on DeTech, MasterGuard, Responsive and Thermalink fire alarms can cause the alarm to fail to signal an alert.

Recall date: October 29, 2015

Recall number: 16-021

Name of product:

Heat-activated fire alarm

Hazard:

A defective fusible link sensor (fuse) on the fire alarm can cause the alarm to fail to alert consumers of a fire.

Remedy:

[Replace](#)

Consumer Contact:

Sure Signal Products toll-free at 855-202-3083 from 8 a.m. to 5 p.m. PT Monday through Friday or at <http://SureSignalProducts.com> and click on CPSC Heat Sensor Recall in the upper right of the page for more information.

[Report an Incident Involving this Product](#)

Units

About 375,000

Description

This recall involves Sure Signal Products heat-activated fire alarms sold under the following brand names and models: DeTech FST2004H, MasterGuard QR50, Responsive TR70-R and Thermalink QR50. They are white, round and measure about 7 inches in diameter. The alarms have a round fuse at the center. The fuse is white or chrome and about 1.5 inches in diameter, and has a temperature rating of 117°F or 136°F. The alarms were manufactured from January 1, 2004 through July 1, 2015. Date codes are listed in a YYDDD format and range from 04001 through 15182. The alarm's model is printed on a label on the back of the alarm. SSP, the temperature rating and the date code can be found on the back of the fuse.

Incidents/Injuries

None reported

Remedy

Consumers should immediately contact Sure Signal Products for free replacement fuses. A video with instructions on how to replace the fuse is available at <http://SureSignalProducts.com>.

Sold at

Fire alarm dealers nationwide from January 2004 through September 2015 for between \$300 and \$375.

Manufacturer(s)

Sure Signal Products, Inc., of Garden Grove, Calif.

Manufactured in

United States

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals — contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at 800-638-2772 or teletypewriter at 301-595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter [@USCPSC](https://twitter.com/USCPSC) or by subscribing to CPSC's [free e-mail newsletters](#).



SSP, temperature rating and date code can be found on the back of the alarm's fuse.



Bosch Security Systems Recalls Wireless Smoke Alarms Due to Failure to Alert Consumers to a Fire (Recall Alert)

[77](#)

The alarms can fail to alert consumers to a fire, posing a fire hazard.

Recall date: September 09, 2015

Recall number: 15-753

Name of product:

Radion wireless smoke alarms

Hazard:

The alarms can fail to alert consumers to a fire, posing a fire hazard.

Remedy:

[Replace](#)

Consumer Contact:

Bosch Security Systems at 800-289-0096 between 8 a.m. and 8 p.m. ET or at www.boschsecurity.us and click on Service and Support, then Customer Service and Presales, then Related Links and go to Technical Bulletins and Safety Recalls at the bottom of the page for more information.

[Report an Incident Involving this Product](#)

Units

About 950

Description

This recall involves Bosch's Radion wireless round smoke alarms installed as part of Bosch security systems. Bosch security alarm systems use a control keypad labeled "Bosch" on the front surface. The alarms are made of white plastic and measure 5.6 inches across and 2.4 inches high. The alarms have a Bosch label on the back with "RFSM-A," a bar code with "F01U263962" and a 17-digit serial number starting with 0922320XXX. The XXX in the 8th through 10th positions of the serial number designates the date code. Only alarms with date codes 001 through 458 are included in the recall.

Incidents/Injuries

Bosch has received two reports that alarms failed to sound during installation testing.

Remedy

Consumers should immediately contact their dealer/installer for a free replacement alarm. Bosch has contacted dealers and installers directly.

Sold at

Security system dealers nationwide from November 2013 through October 2014 for about \$125.

Manufacturer(s)

Bosch Security Systems Inc., Fairport, N.Y.

Manufactured in

China

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals — contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at 800-638-2772 or teletypewriter at 301-595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter @USCPSC or by subscribing to CPSC's [free e-mail newsletters](#).



Recalled Bosch Security
Systems Radion Wireless
Smoke Alarm

Location of Date Code and
Serial Number on back

[440](#)

Philips Recalls Halogen Bulbs Due to Laceration and Burn Hazards

The lens of the bulb can shatter in the lamp or the lens fall off and shatter, posing a laceration and burn hazard.

Recall date: September 10, 2015

Recall number: 15-242

Name of product:

Halogen Bulbs

Hazard:

The lens of the bulb can shatter in the lamp or the lens can fall and shatter, posing a laceration and burn hazard.

Remedy:

[Replace](#)

Consumer Contact:

Philips Lighting North America Corporation at 800-239-6587 from 9 a.m. to 5 p.m. ET Monday through Friday, email at halogenlamp@philips.com and online at www.philips.com/recall and select "United States/English" for more information.

[Report an Incident Involving this Product](#)

Units

About 370,000

Description

This recall involves Philips 60W PAR 16 120V halogen bulbs manufactured from November 2013 to March 2015. Date codes that represent the month and year of production are painted on the bulb glass along with "PHILIPS Halogena PAR 16," "China" and "60W/120/V." Recalled bulb date codes include:

Affected Date Codes:

2013

3L, 3M

2014

4A, 4B, 4C, 4D, 4E, 4F,
4G, 4H, 4J, 4K, 4L, 4M

2015

5A, 5B, 5C

Incidents/Injuries

Philips has received 13 reports of the lens of the bulb shattering, including five reports of property damage totaling about \$700 and two laceration injuries.

Remedy

Consumers should immediately stop using these recalled bulbs, remove them from any fixtures and contact Philips to request packaging materials and instructions for returning the recalled bulbs at no cost. Philips will provide free replacement bulbs.

Sold at

Home Depot stores and professional distributors nationwide and online at www.Amazon.com from November 2013 through March 2015 for about \$10.

Manufacturer(s)

Firstech Lighting Corporation, of Shenzhen, China

Importer(s)

Philips Lighting North America Corporation, of Somerset, N.J.

Manufactured in

China

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals — contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at 800-638-2772 or teletypewriter at 301-595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter @USCPSC or by subscribing to CPSC's [free e-mail newsletters](#).



Actual lamp with etch position
Philips EcoVantage Halogen
Lamp Packaging (front and
back)

Philips Halogenea Lamp
Packaging (front and back)

Philips Halogen Light bulb
box packaging



²⁸⁵ Technical Consumer Products Recalls Connected Brand Downlights Due to Electrical Shock Hazard

The internal wiring in the LED downlights can contact the downlight's metal trim, posing a shock hazard to consumers.

Recall date: September 08, 2015

Recall number: 15-234

Name of product:

LED Downlights for Recessed Cans

Hazard:

The internal wiring in the LED downlights can contact the downlight's metal trim, posing a shock hazard to consumers.

Remedy:

[Replace](#)

Consumer Contact:

Technical Consumer Products at 800-397-2864 from 8 a.m. to 6 p.m. ET Monday through Friday, by email at connected@tcpi.com, or online at www.tcpi.com and click on "Recall" for more information.

[Report an Incident Involving this Product](#)

In conjunction with



Units

About 24,400 (in addition, 6,200 units were sold in Canada)

Description

This recall involves Connected by TCP 5-inch and 6-inch LED Downlight retrofits for recessed cans. These replacement downlights are white and produce a soft white (2700 Kelvin) or bright white (5000 Kelvin) color temperature. Affected units have item number "CD611LC" and the date code printed directly on the black base of the lamp. Consumers will need to shut off power to the lights and disengage the lamp to check the item number and date code. "Connected automated home lighting system" is printed on the product packaging, along with the item number, UPC code and date code.

Item Number	UPC	Description	Date Codes
CD611LC			

UPC# 7-62148- 26168-1	Connected 5"/6" Downlight	1410210
		1424217
		1428217
		1439217
		1444217
		1451217

Incidents/Injuries

None reported.

Remedy

Consumers should immediately contact TCP to receive a free replacement lamp with installation instructions. Consumers should not touch the lamp while it is powered.

Sold at

The Home Depot stores and electrical distributors nationwide and online at Amazon.com from June 2014 through June 2015 for about \$35.

Importer(s)

Technical Consumer Products Inc., of Aurora, Ohio


Manufactured in

China

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals — contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at 800-638-2772 or teletypewriter at 301-595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter @USCPSC or by subscribing to CPSC's [free e-mail newsletters](#).

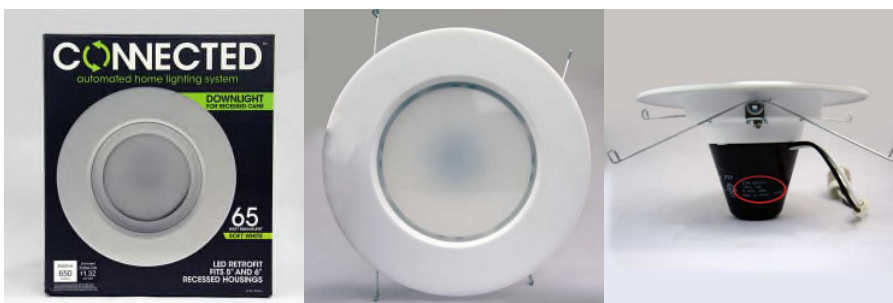

Downlight Bulb in Packaging

Downlight Bulb Front

Downlight Bulb Item Number
Location



Osram Sylvania Recalls T8 LED Tubes Due to Burn Hazard

[305](#)

Lamps can overheat and melt, posing a burn hazard.

Recall date: August 25, 2015

Recall number: 15-223

Name of product:

T8 LED lamps

Hazard:

Lamps can overheat and melt, posing a burn hazard.

Remedy:

[Replace](#)

Consumer Contact:

Osram Sylvania Inc. toll free at 877-423-3772 from 8 a.m. to 6 p.m. ET Monday through Friday or email ProductQuality@sylvania.com or www.sylvania.com and click on the Site Map in the bottom right-hand corner, then click on “Recall Safety Information” for more information.

[Report an Incident Involving this Product](#)

Units

About 46,300 in the U.S. (an additional 8,700 sold in Canada)

Description

This recall involves SubstiTUBE IS T8 LED lamps. The recalled lamps are white, cylindrical in shape and measure 48 inches long and 1 inch in diameter. “OSRAM SubstiTUBE® IS LED T8” is printed on a silver label affixed to the end of lamps. The model number 73312-1 or 73315-1 also appears on the label beneath the statement “Compatible LED T8 for use with instant start T8 electronic ballasts.”

Incidents/Injuries

Osram Sylvania Inc. received 34 reports of overheating and melting. No injuries have been reported.

Remedy

Consumers should immediately stop using the lamps, remove them from the fixture and immediately contact Osram Sylvania for a free replacement.

Sold at

Osram Sylvania industrial/commercial distributors between December 2014 and May 2015.

Importer(s)

Osram Sylvania, Inc., of Danvers, Mass.

Manufactured in

South Korea

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals — contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at 800-638-2772 or teletypewriter at 301-595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter @USCPSC or by subscribing to CPSC's [free e-mail newsletters](#).



T-8 LED Tubes

T-8 LED Tubes

Product Labels

Product Labels



Box Labels

Box Labels



307 Cooper Lighting Recalls Fluorescent Lighting Fixtures Due to Fire Hazard

The socket can overheat, arc and melt, posing a fire hazard.

Recall date: July 15, 2015

Recall number: 15-182

Name of product:

Cooper Lighting, Portfolio and Utilitech fluorescent lighting fixtures

Hazard:

The socket can overheat, arc and melt, posing a fire hazard.

Remedy:

[Replace](#)

Consumer Contact:

Cooper Lighting toll-free at (866) 461-7819 from 8 a.m. to 5 p.m. ET Monday through Friday or online at www.cooperlighting.com and click on "Safety Notices" under the Resources tab for more information.

[Report an Incident Involving this Product](#)

In conjunction with



Units

About 1.62 million (in addition, 27,000 units were sold in Canada)

Description

This recall involves indoor 2-light fluorescent light fixtures that range in size from 18 inches to 4 feet long. The fixtures were sold in white and can be mounted from heights between 8 and 12 feet. A date code between 182 11 (July 1, 2011) and 090 15 (March 31, 2015) is affixed to the fixture near the ballast in a DDD YY format. Catalogue and model numbers are located on the second line of a label affixed to the inside of the fixture. Catalogue and model numbers included in the recall: DLE217RLP, DLE217RLPB, DLE 232RLP, DLE232RLPB, SL232R, SL232R/1, SL232RPC, SL232RTP, SLNR232R, SLNR232R/1, SLNR232RCHR, SLW232R, SLW232R/1, SNF115R, SNF117R, SNF125R, SNF217R, SSF217R, WP217R, WP217RNKLLU, WP232R, WP232RLU, WP232RNKL, WP232RNKLLU and WP232RNKLRL.

Incidents/Injuries

The firm received seven reports of sockets overheating, melting or arcing. No injuries have been reported.

Remedy

Consumers should immediately stop using the light fixture and contact Cooper Lighting for a free replacement.

Sold at

Ace Hardware, Lowe's, Menards, Mills Fleet Farm, True Value and other retail stores nationwide from July 2011 through April 2015 for between \$13 and \$67.

Importer(s)

Cooper Lighting LLC, of Peachtree City, Ga.


Manufactured in

China

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals — contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at (800) 638-2772 or teletypewriter at (301) 595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter [@USCPSC](https://twitter.com/USCPSC) or by subscribing to CPSC's [free e-mail newsletters](#).

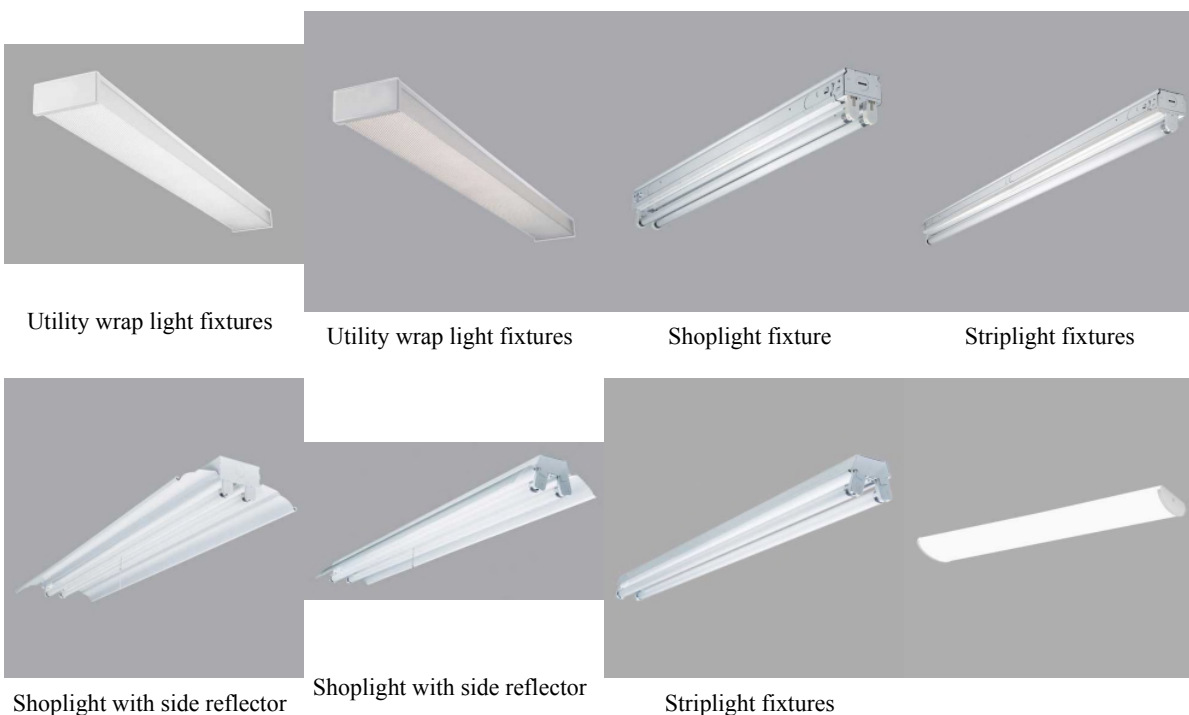



Decorative end wrap light
fixtures

Decorative end wrap light
fixtures

Date code location



⁴⁹⁴ Cree Recalls LED T8 Lamps Due to Burn Hazard

Electrical arcing may cause the lamp to overheat and melt, posing a burn hazard.

Recall date: June 04, 2015

Recall number: 15-159

Name of product:

Cree® LED T8 replacement lamps

Hazard:

Electrical arcing may cause the lamp to overheat and melt, posing a burn hazard.

Remedy:

[Refund/Replace](#)

Consumer Contact:

Cree customer service toll-free at (888) 338-7883 from 8 a.m. to 5 p.m. CT Monday through Friday, email at T8LED@cree.com or online at www.cree.com and click on “Recalls” or go to www.cree.com/recall for more information.

[Report an Incident Involving this Product](#)

In conjunction with



Units

About 700,000 in the U.S. (an additional 11,500 were sold in Canada)

Description

This recall involves Cree LED T8 lamps used indoors to replace traditional two pin T8 fluorescent tubes. The white lamps have a cylindrical shape and measure 48 inches long. The affected units are marked as “BT848 Series Lamp” with the product part number on the lamp itself or printed on a white label affixed to the lamp. A four digit date code is printed on the lamp under a statement that reads “Compatible with Instant Start, Rapid Start and Dimmable Electronic Ballasts.” Product numbers and UPC codes printed on the product packaging included in the recall are listed below:

CONSUMER Product Number	Description	UPC
		849665002932

BT848-17027FLW-BDG13-1C100	Linear LED T8 Replacement Lamp, 4 Ft, 1700 Lm, 2700K – US	
BT848-17040FLW-BDG13-1C100	Linear LED T8 Replacement Lamp, 4 Ft, 1700 Lm, 4000K – US	849665002154

COMMERCIAL Product Number

Description

LEDT8P-48-21L-35K	Linear LED T8 Replacement Lamp, 4 Ft, 2100 Lm, 3500K
LEDT8P-48-21L-40K	Linear LED T8 Replacement Lamp, 4 Ft, 2100 Lm, 4000K
LEDT8P-48-17L-35K	Linear LED T8 Replacement Lamp, 4 Ft, 1700 Lm, 3500K
LEDT8P-48-17L-40K	Linear LED T8 Replacement Lamp, 4 Ft, 1700 Lm, 4000K
LEDT8P-48-17L-30K	Linear LED T8 Replacement Lamp, 4 Ft, 1700 Lm, 3000K
LEDT8P-48-17L-50K	Linear LED T8 Replacement Lamp, 4 Ft, 1700 Lm, 5000K

Date Codes: Any of the above product numbers with any of the following date codes are affected: 3314, 3414, 3514, 3614, 3714, 3814, 3914, 4014, 4114, 4214, 4314, 4414, 4514, 4614, 4714, 4814, 4914, 5014, 5114, 5214, 0115, 0215, 0315, 0415, 0515, 0615, 0715, 0815, 0915, 1015, 1115, 1215, 1315, 1415, 1515, 1615.

Incidents/Injuries

Cree has received four reports of the lamps overheating and melting. No injuries have been reported.

Remedy

Consumers should immediately stop using, disconnect or switch off the fixture, remove the recalled T8 LED lamp, put it in a safe place and contact the firm to receive a full refund or replacement lamp.

Sold at

Sold at The Home Depot® nationwide and to commercial lighting customers through electrical distributors from August 2014 through April 2015 for about \$22 per tube.

Importer(s)

Cree Inc., of Durham, N.C.

Distributor(s)

Cree Inc., of Durham, N.C.

Manufactured in

China

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals — contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at (800) 638-2772 or teletypewriter at (301) 595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter @USCPSC or by subscribing to CPSC's [free e-mail newsletters](#).



Cree® LED T8 Lamp

Product Number: Consumer Package

UPC: Consumer Package

Product Number: Commercial Package



Product Number: Retail / Consumer LED T8 Lamp

Product Number: Commercial LED T8 Lamp

Date Code: Consumer LED T8 Lamp

Date Code: Commercial LED T8 Lamp