



[En Español](#)

GE Lighting Recalls High-Intensity LED Replacement Lamps Due to Impact Hazard

[197](#)

The lamp can separate from its base and fall onto consumers below, posing an impact hazard.

Recall date: March 16, 2016

Recall number: 16-120

Name of product:

High-intensity LED lamps

Hazard:

The lamp can separate from its base and fall onto consumers below, posing an impact hazard.

Remedy:

[Repair](#)

Consumer Contact:

GE Lighting at 800-338-4999 Monday through Friday from 8 a.m. to 8 p.m. ET, email lightingconcerns@ge.com, or online at www.gelighting.com and click on Product Recall at the bottom of the page for more information.

[Report an Incident Involving this Product](#)

In conjunction with



Units

About 35,000 (in addition, about 500 were sold in Mexico)

Description

This recall involves GE Lighting high intensity discharge (HID) LED lamps. The lamps are used in lighting fixtures for warehouses, schools and gymnasiums. The lamps are 5 1/2 inches in diameter by 11 1/2 inches long and weigh about 3 pounds. The lamps were sold in a blue and white carton with “ED37/EX39 base” on the front and “PC:21259” on the back above the bar code. Recalled lamps have the GE logo and the following information on the white plastic base of the lamp: LED165/M400/740, 165W, 4000K, 20000 Lumens, China and date code K213 or K245.

Incidents/Injuries

The firm has received four reports of the lamp separating from the lamp base. No injuries or property damage have been reported.

Remedy

Consumers should immediately contact GE Lighting for a free repair kit and installation guide.

Sold at

GE Lighting authorized dealers and electrical distributors nationwide, including Crescent Electric Supply Company, Graybar and W.W. Grainger Industrial Supply from September 2015 through December 2015 for between \$250 and \$300.

Importer(s)

GE Lighting, of Cleveland, Ohio

Manufactured in

China

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals — contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at 800-638-2772 or teletypewriter at 301-595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter @USCPSC or by subscribing to CPSC's [free e-mail newsletters](#).




GE Lighting high intensity discharge (HID) LED replacement lamp



Date code location



GE HID LED replacement lamp carton (front)

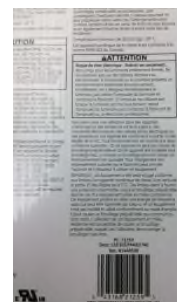

GE HID LED replacement lamp carton (back)

[En Español](#)

IKEA Recalls Ceiling Lamps Due to Laceration Hazard

The plastic retaining clips that secure the glass shades to the lamp housings can break and allow the glass shades to fall, posing a laceration hazard.

[378](#)

Recall date: February 09, 2016

Recall number: 16-098

Name of product:

Ceiling lamps

Hazard:

The plastic retaining clips that secure the glass shades to the lamp housings can break and allow the glass shades to fall, posing a laceration hazard.

Remedy:

[Refund](#)

Consumer Contact:

IKEA toll-free at 888-966-4532 anytime or online at www.ikea-usa.com and click on Press Room at the bottom of the page then Product Recalls for more information.

[Report an Incident Involving this Product](#)

In conjunction with



Units

About 840,000 (in addition, about 427,000 were sold in Canada)

Description

This recall involves Ikea HYBY and LOCK ceiling lamps. The lamps have domed white frosted glass shades and three plastic clips that attach the shade to steel electrical lamp housings. The HYBY has a shade that is 15 inches in diameter and decorated with four opaque concentric lines. The lamp housing holds two light bulbs. The LOCK has a shade that is 10 inches in diameter. The lamp housing holds one light bulb. Type number and the model name of the lamps are on a label attached to the electrical lamp housing. The HYBY is type number T1011 and the LOCK is type number T0201.

Incidents/Injuries

Ikea has received 224 reports of incidents worldwide of retaining clips breaking and glass shades falling from the lamps, including with 11 injuries. Three incidents with no injuries were reported in the U.S.

Remedy

Consumers should immediately stop using the recalled ceiling lamps, uninstall them and return them to any IKEA store for a full refund.

Sold at

IKEA stores worldwide and online at www.ikea-usa.com from October 2012 through January 2016 for about \$13 for the HYBY ceiling lamp, and from November 2002 through January 2016 for about \$5 for the LOCK ceiling lamp.

Importer(s)

IKEA North America Services LLC, of Conshohocken, Pa

Manufactured in

China

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals — contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at 800-638-2772 or teletypewriter at 301-595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter [@USCPSC](https://twitter.com/USCPSC) or by subscribing to CPSC's [free e-mail newsletters](#).



IKEA HYBY ceiling lamp



Label attached to the HYBY electrical lamp housing



IKEA LOCK ceiling lamp



Label attached to the LOCK electrical lamp housing



CE North America Recalls Fan Heaters Due to Fire Hazard; Sold Exclusively at Bed Bath & Beyond

[247](#)

The fan heaters can overheat, posing a fire hazard.

Recall date: February 04, 2016

Recall number: 16-096

Name of product:

KUL Fan Heaters

Hazard:

The fan heaters can overheat, posing a fire hazard.

Remedy:

[Refund](#)

Consumer Contact:

CE North America toll-free at 844-645-3208 from 8:30 a.m. to 5:30 p.m. ET Monday through Friday, email at productrecall@cemglobal.com or online at www.cemglobal.com and click on the “Product Recall” link at the bottom of the page for more information.

[Report an Incident Involving this Product](#)

In conjunction with



Units

About 28,000 in the United States (in addition, about 260 were sold in Canada)

Description

This recall involves KUL small, black portable fan heaters. The KUL logo is printed on the front bottom of the heaters next to the power dial. The fan heater measures about 9 inches long by 5 inches wide by 10.5 inches tall. The fans weigh about two pounds. An adhesive label is on the bottom of the heater with model number “KU39229” and “Date: 0515” in the lower right-hand corner.

Incidents/Injuries

CE North America has received four reports of the fan heaters overheating and catching on fire. No injuries have been reported.

Remedy

Consumers should immediately stop using the recalled fan heaters and contact CE North America for instructions on returning the recalled heaters with a prepaid shipping label. The firm will issue a refund check upon receipt of the returned fan heaters.

Sold exclusively at

Bed, Bath & Beyond stores nationwide and online at www.bedbathandbeyond.com from August 2015 through October 2015 for about \$20.

Importer(s)

CE North America LLC, of Miami, Fla.

Manufactured in

China

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals — contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at 800-638-2772 or teletypewriter at 301-595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter [@USCPSC](https://twitter.com/USCPSC) or by subscribing to CPSC's [free e-mail newsletters](#).



KUL Fan Heater



KUL Fan Heater Model Label



Varaluz Recalls Longfellow Light Fixtures Due to Fire Hazard

[231](#)

Improper wiring can allow melting of the insulation and cause the fixtures to short out, posing fire and shock hazards.

Recall date: January 28, 2016

Recall number: 16-086

Name of product:

Longfellow lighting fixtures for indoor and outdoor use

Hazard:

Improper wiring can allow melting of the insulation and cause the fixtures to short out, posing fire and shock hazards.

Remedy:

[RepairRefund](#)

Consumer Contact:

Varaluz collect at 702-792-6900 from 8 a.m. to 5 p.m. PT Monday through Friday, or online at www.varaluz.com and click on the recall news article at the bottom of the homepage for more information.

Consumers can also email the firm at customerservice@varaluz.com.

[Report an Incident Involving this Product](#)

Units

About 80

Description

This recall involves all Longfellow model 3- and 4-light light fixtures for indoor or outdoor use. The black metal fixtures have a clear/frosted glass shade on four sides and can be wall mounted or ceiling mounted. Model number 731KL04EB, 731KM03EB, 731P03EB, 331P03BL, 731P04EB or 331P04BL is printed on the label on the canopy of the ceiling mounted fixtures or the backplate of wall mounted fixtures.

Incidents/Injuries

The firm has received two reports of lights bulbs shorting. No injuries have been reported.

Remedy

Consumers should immediately discontinue use of the fixtures until replacement units are available. Consumers should contact Varaluz for a replacement light fixture or a refund.

Sold at

Lighting showrooms nationwide and online through lighting and home improvement websites from April 2013 to September 2015 for between \$320 and \$420.

Importer(s)

Varaluz LLC, of Las Vegas, Nev.

Manufactured in

Philippines

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals — contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at 800-638-2772 or teletypewriter at 301-595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter [@USCPSC](https://twitter.com/USCPSC) or by subscribing to CPSC's [free e-mail newsletters](#).



731P03EB/331P03EB 3-Lt
Indoor/Outdoor Pendant



731P04EB/331P04EB 4-Lt
Indoor/Outdoor Pendant



731KL04EB 4-Lt Large
Outdoor Wall Bracket



731KM03EB 3-Lt Medium
Outdoor Wall Bracket



Lunera Recalls LED Lamps Due to Fire, Burn and Electric Shock Hazards (Recall Alert)

[40](#)

The Helen GX23 LED lamps can overheat, posing fire, burn and electric shock hazards.

Recall date: January 27, 2016

Recall number: 16-724

Name of product:

Helen GX23 LED lamps

Hazard:

Lamps can overheat, posing fire, burn and electric shock hazards.

Remedy:

[Refund](#)

Consumer Contact:

Lunera at 800-637-3089 from 8 a.m. to 6 p.m. PT Monday through Friday or www.lunera.com and click on Recall for more information.

[Report an Incident Involving this Product](#)

In conjunction with



Units

About 60,000 (an additional 1,000 sold in Canada)

Description

This recall involves Lunera 13 watt Helen GX23 LED industrial lamps. The dimmable lamps are white and measure 6 inches long by 1.25 inches wide by 0.75 inches thick. The Lunera logo is printed on the front on the lamp at one end. Model numbers HN-H-UNV-GX23-13W-2700-G3, HN-H-UNV-GX23-13W-3000-G3, HN-H-UNV-GX23-13W-3500-G3 and HN-H-UNV-GX23-13W-4000-G3 appear on the back of the connector. The date code, ranging from 1501 to 1552, is stamped on the bottom of the connector.

Incidents/Injuries

Lunera has received 11 reports of lamps overheating. No injuries have been reported.

Remedy

Consumers should immediately stop using the recalled lamps and contact Lunera for a full refund.

Sold at

FSG, Grainger, Nedco, Standard Electric and other Lunera industrial/commercial retailers and online at www.1000bulbs.com and www.bulbs.com from October 2015 through December 2015 for about \$25.

Importer(s)

Lunera Lighting Inc., of Santa Clara, Calif.

Manufactured in

China

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals -- contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at 800-638-2772 or teletypewriter at 301-595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter [@USCPSC](https://twitter.com/USCPSC) or by subscribing to CPSC's [free e-mail newsletters](#).



Lunera 13 watt Helen GX23 LED lamp The model appears on the back of the connector. The date code is stamped on the bottom of the connector.



Casablanca Recalls Ceiling Fans Due to Injury Hazard

The fan motor and attached blades can separate from the adapter when operating in reverse updraft mode, causing the fan motor and blades to fall, posing an injury hazard.

[250](#)

Recall date: December 17, 2015

Recall number: 16-064

Name of product:

Casablanca ceiling fans

Hazard:

The fan motor and attached blades can separate from the adapter when operating in reverse updraft mode, causing the fan motor and blades to fall, posing an injury hazard.

Remedy:

[Repair](#)

Consumer Contact:

Casablanca toll-free at 855-800-3789 from 8 a.m. to 8 p.m. ET Monday through Friday or online at www.casablancafanco.com and click on the “Safety & Recall” tab at the bottom of the page for more information.

[Report an Incident Involving this Product](#)

Units

About 30,000

Description

This recall involves 43 models of Casablanca ceiling fans manufactured in 2013 and 2014. Casablanca fan styles including: Alessandria, Aris, Bel Air, Bullet, Caneel Bay, Heritage, Isotope, Riello, Stealth, Tercera, Trident, Whitman and Zudio. Affected models have a gold label on top of the motor housing that includes “Casablanca” and a model number. Some Casablanca models also have the Casablanca logo on the switch housing or on the end of the pull chain. The production date code is a four digit code on top of the motor housing near the center down rod. Fans with a Cat. No. “A01”, the last two digits of the four digit date code ending in “13” or “14” and no green dot on top of the motor housing are included in the recall.

Casablanca ceiling fan model numbers and production dates included in this recall are:

Model Numbers	Production Date = last two digits of production code	Factory Code	Green Dot on Motor Housing
59018, 59019, 59020, 59021, 59022, 59023, 59057, 59059, 59060, 59061, 59062, 59064, 59065, 59068, 59069, 59070, 59076, 59077, 59078, 59081	Production codes xx13 and xx14	A01	No

59082, 59083, 59090, 59091,
59092, 59093, 59094, 59105,
59106, 59107, 59109, 59110,
59111, 59113, 59114, 59119,
59121, 59123, 59124, 59164,
59165, 59527, 59528

For all Isotope model ceiling fans (model numbers: 59018, 59019, 59020, 59021, 59022, 59023), the canopy ring next to the ceiling must be twisted and lowered to see the product information labels and the presence of a green dot.

Incidents/Injuries

Casablanca has received eight reports of the fan motor and blades falling, including one report of minor injury and one report of minor property damage.

Remedy

Consumers should immediately stop using the recalled ceiling fans and contact Casablanca for a free in-home inspection and repair.

Sold at

Lighting store showrooms nationwide and major home improvement online retailers from January 2013 through December 2014 for between \$350 and \$620.

Importer(s)

Casablanca Fan Company, of Memphis, Tenn.

Manufactured in

China

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals — contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at 800-638-2772 or teletypewriter at 301-595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter [@USCPSC](https://twitter.com/USCPSC) or by subscribing to CPSC's [free e-mail newsletters](#).



Casablanca ceiling fan model
and date code location

Casablanca fan model number
and factory code label



Casablanca green inspection
dot

Casablanca ceiling fan date
code



Lithonia Lighting Recalls Light Fixtures Due to Risk of Injury (Recall Alert)

[18](#)

The metal hub used to mount the light fixtures to the ceiling can break and allow the fixture to fall unexpectedly, posing a risk of injury from impact.

Recall date: December 15, 2015

Recall number: 16-715

Name of product:

JHBL LED Fixtures

Hazard:

The metal hub used to mount the light fixtures to the ceiling can break and allow the fixture to fall unexpectedly, posing a risk of injury from impact.

Remedy:

[Repair](#)

Consumer Contact:

Lithonia Lighting at 800-315-4963 from 8 a.m. to 5 p.m. ET Monday through Friday, or online at www.lithonia.com and click on “JHBL LED Recall Information” on the left side of the page for more information.

[Report an Incident Involving this Product](#)

Units

About 6,500

Description

This recall involves JHBL LED light fixtures manufactured between August 2014 and June 20, 2015. Manufacture dates are located on the product label near the top of the light fixture. The light fixtures measure 16-inches high by 22-inches wide and weigh about 40 pounds. The fixtures are painted white die castings with raised heat dissipating fins every 2 inches. The lower die casting with fins is approximately 4 inches from the driver compartment box. Units shipped after June 20, 2015 are not included in the recall.

Incidents/Injuries

Lithonia Lighting has received eight reports of hubs on the light fixture breaking, including four reports of the fixtures falling. No injuries have been reported.

Remedy

Consumers should immediately contact Lithonia Lighting to receive a free chain to secure the fixture to the ceiling. Lithonia Lighting is contacting all known customers.

Sold at

Electrical distributors nationwide from August 2014 through June 2015 for about \$520.

Importer(s)

Acuity Brands Lighting, Inc., of Conyers, Ga., Lithonia Lighting is a division

Manufactured in

Mexico

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals — contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at 800-638-2772 or teletypewriter at 301-595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter [@USCPSC](https://twitter.com/USCPSC) or by subscribing to CPSC's [free e-mail newsletters](#).



Lithonia JHBL LED Fixture



Basler Electric Recalls Transformers Due to Fire, Shock Hazards (Recall Alert)

[16](#)

The circuit breaker in the transformer can fail to trip, posing fire and electrical shock hazards.

Recall date: December 09, 2015

Recall number: 16-711

Name of product:

Electrical transformers

Hazard:

The circuit breaker in the transformer can fail to trip, posing fire and electrical shock hazards.

Remedy:

[Replace](#)

Consumer Contact:

Manufacturers and distributors can contact Basler collect at 618-654-2341 ext. 230 between 8 a.m. and 5 p.m. CT Monday through Friday. Manufacturers and distributors have been advised by Basler Electric that they should immediately contact consumers who have the recalled transformers.

[Report an Incident Involving this Product](#)

Units

About 11,900

Description

This recall involves Basler Class 2 electric transformers with date codes between 1435 and 1446 which use a Tyco circuit breaker. The date code is located on the top line of the transformer's data plate.

Incidents/Injuries

None reported

Remedy

Manufacturers and distributors should immediately stop distributing the recalled transformers and contact Basler to receive free replacement transformers. Due to the risk of shock, consumers should not attempt to open or replace the recalled transformers on their own but should contact the manufacturer of their product for further instructions. Basler has notified manufacturers and distributors about the recall directly.

Sold at

Basler Electric to manufacturers and distributors of end products that contain these transformers from September 2014 to November 2014 for various prices.

Manufacturer(s)

Basler Electric Company, of Highland, Ill.

Manufactured in

Mexico

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals — contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at 800-638-2772 or teletypewriter at 301-595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter [@USCPSC](https://twitter.com/USCPSC) or by subscribing to CPSC's [free e-mail newsletters](#).



Basler Class 2 electric
transformers



Technical Consumer Products Recalls LED Lamps Due to Electrical Shock Hazard

[223](#)

Water can enter the lamp in wet location applications, posing an electric shock hazard to the user.

Recall date: December 08, 2015

Recall number: 16-054

Name of product:

Technical Consumer Products (TCP) and Great Value LED lamps

Hazard:

Water can enter the lamp in wet location applications, posing an electric shock hazard to the user.

Remedy:

[Replace](#)

Consumer Contact:

TCP at 800-324-1496 from 8 a.m. to 6 p.m. ET Monday through Friday, by email at recall@tcpi.com or online at www.tcpi.com and click on "Recall" for more information.

[Report an Incident Involving this Product](#)

In conjunction with



Units

About 25,000 (in addition about 1,350 were sold in Canada)

Description

This recall involves 14 watt LED wet location PAR38 lamps sold under the TCP and Great Value Brand names. These lamps are white and produce a soft white (3000 Kelvin) or bright white (5000 Kelvin) color temperature. Recalled units have an item number of "L14P38D30KFL", "L14P38D50KFL", "RLP381430WL" or "GVRLP381430WL" and the date code printed directly on the white plastic heat sink of the lamp, just above the screw in base. Consumers will need to shut off power to the lights and disengage the lamp to check the item number and date code.

Item Number	Brand	UPC	Description	Date Code
L14P38D30KFL	TCP	7-6214804626-4		1523211

			14 watt LED PAR38 Wet Location 3,000K	1523212
L14P38D50KFL	TCP	7-6214804668-4	14 watt LED PAR38 Wet Location 5,000K	1524211
				1528216
RLP381430WL	TCP	7-6214827059-1	14 watt LED PAR38 Wet Location 3,000K	1532216
				1530212
GVRLP381430WL	Great Value	6-8113107221-2	14 watt LED PAR38 Wet Location 3,000K	1527211
				1530212

Incidents/Injuries

None reported

Remedy

Consumers should immediately shut off power to the lights, remove the lamps to check the item number/date code of the recall, and contact TCP to receive a free replacement lamp with installation instructions.

Sold at

Walmart and electrical distributors nationwide from May 2015 through October 2015 for about \$20.

Importer(s)

Technical Consumer Products Inc., of Aurora, Ohio

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals — contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at 800-638-2772 or teletypewriter at 301-595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter [@USCPSC](https://twitter.com/USCPSC) or by subscribing to CPSC's [free e-mail newsletters](#).



TCP Lamp L14P38D30KFL and L14P38D50KFL in Packaging



TCP Lamp RPLP381430WL in Packaging



Great Value Lamp GVRLP381430WL in Packaging



LED 14 watt PAR38 Wet Location Bulb



LED 14 watt PAR38 Wet Location Item Number Location



[En Español](#)

453 Sure Signal Products Recalls Heat-Activated Fire Alarms Due to Failure to Alert Consumers of a Fire

A defective fuse on DeTech, MasterGuard, Responsive and Thermalink fire alarms can cause the alarm to fail to signal an alert.

Recall date: October 29, 2015

Recall number: 16-021

Name of product:

Heat-activated fire alarm

Hazard:

A defective fusible link sensor (fuse) on the fire alarm can cause the alarm to fail to alert consumers of a fire.

Remedy:

[Replace](#)

Consumer Contact:

Sure Signal Products toll-free at 855-202-3083 from 8 a.m. to 5 p.m. PT Monday through Friday or at <http://SureSignalProducts.com> and click on CPSC Heat Sensor Recall in the upper right of the page for more information.

[Report an Incident Involving this Product](#)

Units

About 375,000

Description

This recall involves Sure Signal Products heat-activated fire alarms sold under the following brand names and models: DeTech FST2004H, MasterGuard QR50, Responsive TR70-R and Thermalink QR50. They are white, round and measure about 7 inches in diameter. The alarms have a round fuse at the center. The fuse is white or chrome and about 1.5 inches in diameter, and has a temperature rating of 117°F or 136°F. The alarms were manufactured from January 1, 2004 through July 1, 2015. Date codes are listed in a YYDDD format and range from 04001 through 15182. The alarm's model is printed on a label on the back of the alarm. SSP, the temperature rating and the date code can be found on the back of the fuse.

Incidents/Injuries

None reported

Remedy

Consumers should immediately contact Sure Signal Products for free replacement fuses. A video with instructions on how to replace the fuse is available at <http://SureSignalProducts.com>.

Sold at

Fire alarm dealers nationwide from January 2004 through September 2015 for between \$300 and \$375.

Manufacturer(s)

Sure Signal Products, Inc., of Garden Grove, Calif.

Manufactured in

United States

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals — contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at 800-638-2772 or teletypewriter at 301-595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter [@USCPSC](https://twitter.com/USCPSC) or by subscribing to CPSC's [free e-mail newsletters](#).



SSP, temperature rating and date code can be found on the back of the alarm's fuse.



Bosch Security Systems Recalls Wireless Smoke Alarms Due to Failure to Alert Consumers to a Fire (Recall Alert)

[77](#)

The alarms can fail to alert consumers to a fire, posing a fire hazard.

Recall date: September 09, 2015

Recall number: 15-753

Name of product:

Radion wireless smoke alarms

Hazard:

The alarms can fail to alert consumers to a fire, posing a fire hazard.

Remedy:

[Replace](#)

Consumer Contact:

Bosch Security Systems at 800-289-0096 between 8 a.m. and 8 p.m. ET or at www.boschsecurity.us and click on Service and Support, then Customer Service and Presales, then Related Links and go to Technical Bulletins and Safety Recalls at the bottom of the page for more information.

[Report an Incident Involving this Product](#)

Units

About 950

Description

This recall involves Bosch's Radion wireless round smoke alarms installed as part of Bosch security systems. Bosch security alarm systems use a control keypad labeled "Bosch" on the front surface. The alarms are made of white plastic and measure 5.6 inches across and 2.4 inches high. The alarms have a Bosch label on the back with "RFSM-A," a bar code with "F01U263962" and a 17-digit serial number starting with 0922320XXX. The XXX in the 8th through 10th positions of the serial number designates the date code. Only alarms with date codes 001 through 458 are included in the recall.

Incidents/Injuries

Bosch has received two reports that alarms failed to sound during installation testing.

Remedy

Consumers should immediately contact their dealer/installer for a free replacement alarm. Bosch has contacted dealers and installers directly.

Sold at

Security system dealers nationwide from November 2013 through October 2014 for about \$125.

Manufacturer(s)

Bosch Security Systems Inc., Fairport, N.Y.

Manufactured in

China

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals — contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at 800-638-2772 or teletypewriter at 301-595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter @USCPSC or by subscribing to CPSC's [free e-mail newsletters](#).



Recalled Bosch Security
Systems Radion Wireless
Smoke Alarm

Location of Date Code and
Serial Number on back

[440](#)

Philips Recalls Halogen Bulbs Due to Laceration and Burn Hazards

The lens of the bulb can shatter in the lamp or the lens fall off and shatter, posing a laceration and burn hazard.

Recall date: September 10, 2015

Recall number: 15-242

Name of product:

Halogen Bulbs

Hazard:

The lens of the bulb can shatter in the lamp or the lens can fall and shatter, posing a laceration and burn hazard.

Remedy:

[Replace](#)

Consumer Contact:

Philips Lighting North America Corporation at 800-239-6587 from 9 a.m. to 5 p.m. ET Monday through Friday, email at halogenlamp@philips.com and online at www.philips.com/recall and select "United States/English" for more information.

[Report an Incident Involving this Product](#)

Units

About 370,000

Description

This recall involves Philips 60W PAR 16 120V halogen bulbs manufactured from November 2013 to March 2015. Date codes that represent the month and year of production are painted on the bulb glass along with "PHILIPS Halogena PAR 16," "China" and "60W/120/V." Recalled bulb date codes include:

Affected Date Codes:

2013

3L, 3M

2014

4A, 4B, 4C, 4D, 4E, 4F,
4G, 4H, 4J, 4K, 4L, 4M

2015

5A, 5B, 5C

Incidents/Injuries

Philips has received 13 reports of the lens of the bulb shattering, including five reports of property damage totaling about \$700 and two laceration injuries.

Remedy

Consumers should immediately stop using these recalled bulbs, remove them from any fixtures and contact Philips to request packaging materials and instructions for returning the recalled bulbs at no cost. Philips will provide free replacement bulbs.

Sold at

Home Depot stores and professional distributors nationwide and online at www.Amazon.com from November 2013 through March 2015 for about \$10.

Manufacturer(s)

Firstech Lighting Corporation, of Shenzhen, China

Importer(s)

Philips Lighting North America Corporation, of Somerset, N.J.

Manufactured in

China

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals — contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at 800-638-2772 or teletypewriter at 301-595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter @USCPSC or by subscribing to CPSC's [free e-mail newsletters](#).



Actual lamp with etch position
Philips EcoVantage Halogen
Lamp Packaging (front and
back)

Philips Halogenea Lamp
Packaging (front and back)

Philips Halogen Light bulb
box packaging



285 Technical Consumer Products Recalls Connected Brand Downlights Due to Electrical Shock Hazard

The internal wiring in the LED downlights can contact the downlight's metal trim, posing a shock hazard to consumers.

Recall date: September 08, 2015

Recall number: 15-234

Name of product:

LED Downlights for Recessed Cans

Hazard:

The internal wiring in the LED downlights can contact the downlight's metal trim, posing a shock hazard to consumers.

Remedy:

[Replace](#)

Consumer Contact:

Technical Consumer Products at 800-397-2864 from 8 a.m. to 6 p.m. ET Monday through Friday, by email at connected@tcpi.com, or online at www.tcpi.com and click on "Recall" for more information.

[Report an Incident Involving this Product](#)

In conjunction with



Units

About 24,400 (in addition, 6,200 units were sold in Canada)

Description

This recall involves Connected by TCP 5-inch and 6-inch LED Downlight retrofits for recessed cans. These replacement downlights are white and produce a soft white (2700 Kelvin) or bright white (5000 Kelvin) color temperature. Affected units have item number "CD611LC" and the date code printed directly on the black base of the lamp. Consumers will need to shut off power to the lights and disengage the lamp to check the item number and date code. "Connected automated home lighting system" is printed on the product packaging, along with the item number, UPC code and date code.

Item Number	UPC	Description	Date Codes
CD611LC			

UPC# 7-62148- 26168-1	Connected 5"/6" Downlight	1410210
		1424217
		1428217
		1439217
		1444217
		1451217

Incidents/Injuries

None reported.

Remedy

Consumers should immediately contact TCP to receive a free replacement lamp with installation instructions. Consumers should not touch the lamp while it is powered.

Sold at

The Home Depot stores and electrical distributors nationwide and online at Amazon.com from June 2014 through June 2015 for about \$35.

Importer(s)

Technical Consumer Products Inc., of Aurora, Ohio


Manufactured in

China

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals — contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at 800-638-2772 or teletypewriter at 301-595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter @USCPSC or by subscribing to CPSC's [free e-mail newsletters](#).

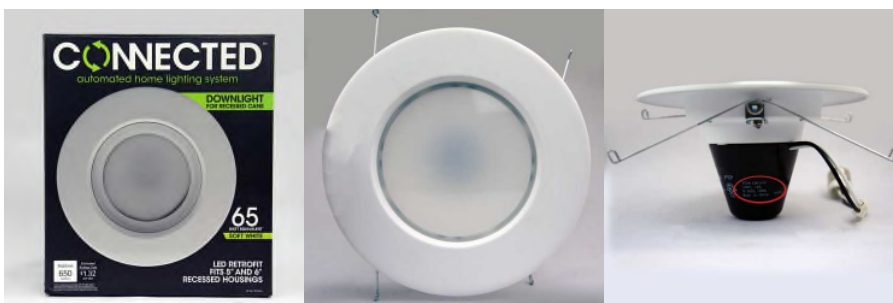

Downlight Bulb in Packaging

Downlight Bulb Front

Downlight Bulb Item Number
Location



Osram Sylvania Recalls T8 LED Tubes Due to Burn Hazard

[305](#)

Lamps can overheat and melt, posing a burn hazard.

Recall date: August 25, 2015

Recall number: 15-223

Name of product:

T8 LED lamps

Hazard:

Lamps can overheat and melt, posing a burn hazard.

Remedy:

[Replace](#)

Consumer Contact:

Osram Sylvania Inc. toll free at 877-423-3772 from 8 a.m. to 6 p.m. ET Monday through Friday or email ProductQuality@sylvania.com or www.sylvania.com and click on the Site Map in the bottom right-hand corner, then click on “Recall Safety Information” for more information.

[Report an Incident Involving this Product](#)

Units

About 46,300 in the U.S. (an additional 8,700 sold in Canada)

Description

This recall involves SubstiTUBE IS T8 LED lamps. The recalled lamps are white, cylindrical in shape and measure 48 inches long and 1 inch in diameter. “OSRAM SubstiTUBE® IS LED T8” is printed on a silver label affixed to the end of lamps. The model number 73312-1 or 73315-1 also appears on the label beneath the statement “Compatible LED T8 for use with instant start T8 electronic ballasts.”

Incidents/Injuries

Osram Sylvania Inc. received 34 reports of overheating and melting. No injuries have been reported.

Remedy

Consumers should immediately stop using the lamps, remove them from the fixture and immediately contact Osram Sylvania for a free replacement.

Sold at

Osram Sylvania industrial/commercial distributors between December 2014 and May 2015.

Importer(s)

Osram Sylvania, Inc., of Danvers, Mass.

Manufactured in

South Korea

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals — contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at 800-638-2772 or teletypewriter at 301-595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter @USCPSC or by subscribing to CPSC's [free e-mail newsletters](#).



T-8 LED Tubes

T-8 LED Tubes

Product Labels

Product Labels



Box Labels

Box Labels



307 Cooper Lighting Recalls Fluorescent Lighting Fixtures Due to Fire Hazard

The socket can overheat, arc and melt, posing a fire hazard.

Recall date: July 15, 2015

Recall number: 15-182

Name of product:

Cooper Lighting, Portfolio and Utilitech fluorescent lighting fixtures

Hazard:

The socket can overheat, arc and melt, posing a fire hazard.

Remedy:

[Replace](#)

Consumer Contact:

Cooper Lighting toll-free at (866) 461-7819 from 8 a.m. to 5 p.m. ET Monday through Friday or online at www.cooperlighting.com and click on "Safety Notices" under the Resources tab for more information.

[Report an Incident Involving this Product](#)

In conjunction with



Units

About 1.62 million (in addition, 27,000 units were sold in Canada)

Description

This recall involves indoor 2-light fluorescent light fixtures that range in size from 18 inches to 4 feet long. The fixtures were sold in white and can be mounted from heights between 8 and 12 feet. A date code between 182 11 (July 1, 2011) and 090 15 (March 31, 2015) is affixed to the fixture near the ballast in a DDD YY format. Catalogue and model numbers are located on the second line of a label affixed to the inside of the fixture. Catalogue and model numbers included in the recall: DLE217RLP, DLE217RLPB, DLE 232RLP, DLE232RLPB, SL232R, SL232R/1, SL232RPC, SL232RTP, SLNR232R, SLNR232R/1, SLNR232RCHR, SLW232R, SLW232R/1, SNF115R, SNF117R, SNF125R, SNF217R, SSF217R, WP217R, WP217RNKLLU, WP232R, WP232RLU, WP232RNKL, WP232RNKLLU and WP232RNKLRL.

Incidents/Injuries

The firm received seven reports of sockets overheating, melting or arcing. No injuries have been reported.

Remedy

Consumers should immediately stop using the light fixture and contact Cooper Lighting for a free replacement.

Sold at

Ace Hardware, Lowe's, Menards, Mills Fleet Farm, True Value and other retail stores nationwide from July 2011 through April 2015 for between \$13 and \$67.

Importer(s)

Cooper Lighting LLC, of Peachtree City, Ga.


Manufactured in

China

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals — contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at (800) 638-2772 or teletypewriter at (301) 595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter [@USCPSC](https://twitter.com/USCPSC) or by subscribing to CPSC's [free e-mail newsletters](#).

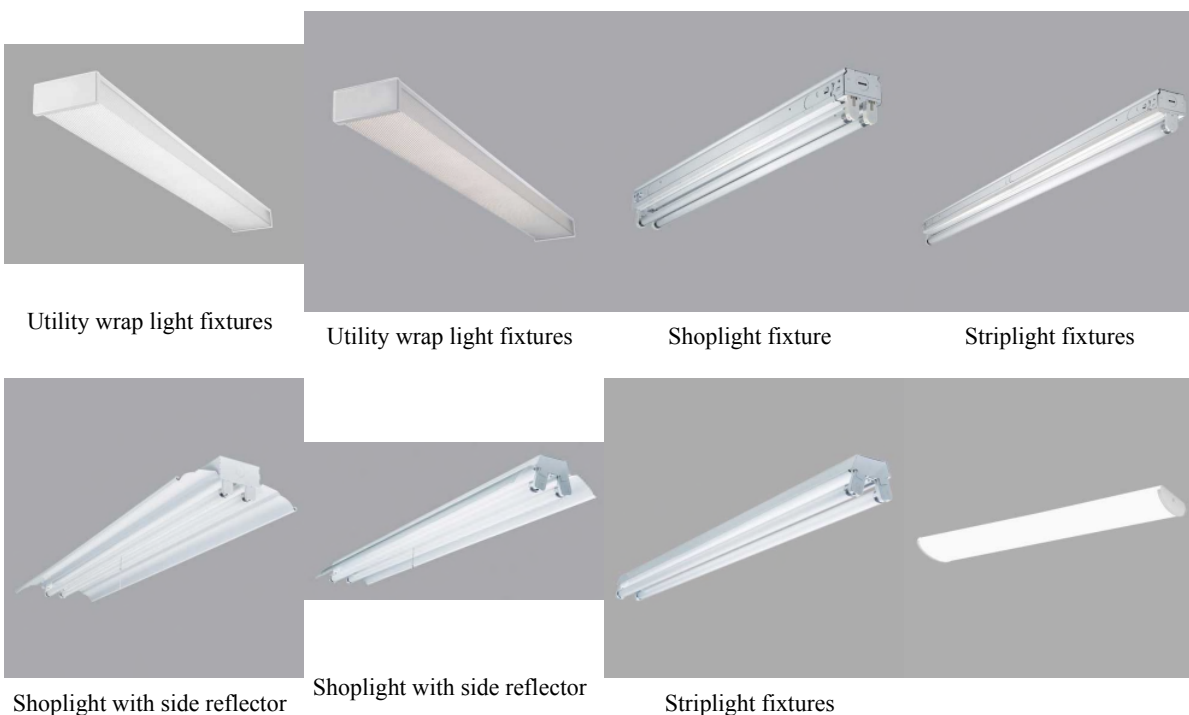



Decorative end wrap light
fixtures

Decorative end wrap light
fixtures

Date code location



⁴⁹⁴ Cree Recalls LED T8 Lamps Due to Burn Hazard

Electrical arcing may cause the lamp to overheat and melt, posing a burn hazard.

Recall date: June 04, 2015

Recall number: 15-159

Name of product:

Cree® LED T8 replacement lamps

Hazard:

Electrical arcing may cause the lamp to overheat and melt, posing a burn hazard.

Remedy:

[Refund/Replace](#)

Consumer Contact:

Cree customer service toll-free at (888) 338-7883 from 8 a.m. to 5 p.m. CT Monday through Friday, email at T8LED@cree.com or online at www.cree.com and click on “Recalls” or go to www.cree.com/recall for more information.

[Report an Incident Involving this Product](#)

In conjunction with



Units

About 700,000 in the U.S. (an additional 11,500 were sold in Canada)

Description

This recall involves Cree LED T8 lamps used indoors to replace traditional two pin T8 fluorescent tubes. The white lamps have a cylindrical shape and measure 48 inches long. The affected units are marked as “BT848 Series Lamp” with the product part number on the lamp itself or printed on a white label affixed to the lamp. A four digit date code is printed on the lamp under a statement that reads “Compatible with Instant Start, Rapid Start and Dimmable Electronic Ballasts.” Product numbers and UPC codes printed on the product packaging included in the recall are listed below:

**CONSUMER Product
Number**

Description

UPC

849665002932

BT848-17027FLW-BDG13-1C100	Linear LED T8 Replacement Lamp, 4 Ft, 1700 Lm, 2700K – US	
BT848-17040FLW-BDG13-1C100	Linear LED T8 Replacement Lamp, 4 Ft, 1700 Lm, 4000K – US	849665002154

COMMERCIAL Product Number

Description

LEDT8P-48-21L-35K	Linear LED T8 Replacement Lamp, 4 Ft, 2100 Lm, 3500K
LEDT8P-48-21L-40K	Linear LED T8 Replacement Lamp, 4 Ft, 2100 Lm, 4000K
LEDT8P-48-17L-35K	Linear LED T8 Replacement Lamp, 4 Ft, 1700 Lm, 3500K
LEDT8P-48-17L-40K	Linear LED T8 Replacement Lamp, 4 Ft, 1700 Lm, 4000K
LEDT8P-48-17L-30K	Linear LED T8 Replacement Lamp, 4 Ft, 1700 Lm, 3000K
LEDT8P-48-17L-50K	Linear LED T8 Replacement Lamp, 4 Ft, 1700 Lm, 5000K

Date Codes: Any of the above product numbers with any of the following date codes are affected: 3314, 3414, 3514, 3614, 3714, 3814, 3914, 4014, 4114, 4214, 4314, 4414, 4514, 4614, 4714, 4814, 4914, 5014, 5114, 5214, 0115, 0215, 0315, 0415, 0515, 0615, 0715, 0815, 0915, 1015, 1115, 1215, 1315, 1415, 1515, 1615.

Incidents/Injuries

Cree has received four reports of the lamps overheating and melting. No injuries have been reported.

Remedy

Consumers should immediately stop using, disconnect or switch off the fixture, remove the recalled T8 LED lamp, put it in a safe place and contact the firm to receive a full refund or replacement lamp.

Sold at

Sold at The Home Depot® nationwide and to commercial lighting customers through electrical distributors from August 2014 through April 2015 for about \$22 per tube.

Importer(s)

Cree Inc., of Durham, N.C.

Distributor(s)

Cree Inc., of Durham, N.C.

Manufactured in

China

The U.S. Consumer Product Safety Commission is charged with protecting the public from unreasonable risks of injury or death associated with the use of thousands of types of consumer products under the agency's jurisdiction. Deaths, injuries, and property damage from consumer product incidents cost the nation more than \$1 trillion annually. CPSC is committed to protecting consumers and families from products that pose a fire, electrical, chemical or mechanical hazard. CPSC's work to help ensure the safety of consumer products - such as toys, cribs, power tools, cigarette lighters and household chemicals — contributed to a decline in the rate of deaths and injuries associated with consumer products over the past 40 years.

Federal law bars any person from selling products subject to a publicly-announced voluntary recall by a manufacturer or a mandatory recall ordered by the Commission.

To report a dangerous product or a product-related injury go online to www.SaferProducts.gov or call CPSC's Hotline at (800) 638-2772 or teletypewriter at (301) 595-7054 for the hearing impaired. Consumers can obtain news release and recall information at www.cpsc.gov, on Twitter @USCPSC or by subscribing to CPSC's [free e-mail newsletters](#).



Cree® LED T8 Lamp

Product Number: Consumer Package

UPC: Consumer Package

Product Number: Commercial Package



Product Number: Retail / Consumer LED T8 Lamp

Product Number: Commercial LED T8 Lamp

Date Code: Consumer LED T8 Lamp

Date Code: Commercial LED T8 Lamp